

Assembly instructions for LuK RepSet[®] 621 3027 09/33/34, 621 3045 09/33 and 621 3050 09/33

Manufacturers:

Opel, Vauxhall

Models: Astra G/H, Combo, Corsa C, Meriva, Signum, Vectra C, Zafira B Engines: Z16XEP, Z16YNG Z18XE, Z18XER

Gearbox: F17

LuK RepSet®: 621 3027 09/33/34 621 3045 09/33 621 3050 09/33

Flywheel OE no.:

90536140 / 616169 93186460 / 5616016

In the models listed, the clutch can sometimes grab. The problem mainly occurs after long standing times and in ambient temperatures below 10°C.

From May 2007, the vehicle manufacturer has therefore installed a modified clutch and flywheel as standard. As a result, the flywheel depth changed from 19 to 21.6 mm.

For production engine number change points refer to Schaeffler-Aftermarket.com and TecDoc.





Image 1: OE no. 90536140 / 616169 without indentation around the circumference, flywheel depth 19 mm

Vehicles produced before May 2007, that exhibited the same fault were also retrofitted with these parts at the workshop; this is indicated by a green dot on the gearbox (see Image 3).



Image 3: Marking on gearbox



Image 2: OE no. 93186460 / 5616016 with indentation around the circumference, flywheel depth 21.6 mm

The different characteristics of the flywheels are illustrated in Images 1 and 2.

The following clutch sets must be used with the different flywheels:

Flywheel OE no	LuK RepSet®
90536140/616169 gearbox without coloured marking, flywheel depth 19 mm	621 3027 09 621 3027 33 621 3027 34
93186460/5616016 gearbox with coloured marking, flywheel depth 21,6 mm	621 3045 09 621 3045 33 621 3050 09 621 3050 33



Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or in RepXpert at www.RepXpert.com.

Issued 10.2011

LuK 0030 Technical subject to change © 2011 Schaeffler Automotive Aftermarket



For further information:

Phone: +44 (0) 14 32 264 264* Fax: +44 (0) 14 32 375 760 Info@LuK-AS.co.uk www.Schaeffler-Aftermarket.com * Calls from within the UK 08457 001100